

Date: Friday, 1/25/2008 10:55:42 AM  
 User: Kim Johnston

## Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 407 HIGH AFT X-TUBE ASSEMBLY  
 Job Number : 37006  
 Estimate Number : 10528  
 P.O. Number :  
 This Issue : 1/25/2008 S.O. No. :  
 Prsht Rev. : NC Part Number : D407667205  
 First Issue : / / Type : LANDING GEAR Drawing Number : D407-667-245 REV D  
 Previous Run : 36386 Material :  
 Written By : Due Date : 3/10/2008 Qty: 1 Um: Each  
 Checked & Approved By : JA 03 DI 25  
 Comment : Est Rev: C 05.09.02 Add holes for compatibility with Bell  
 Skidtubes KJ/JLM  
 Est Rev: D Added Magnobond, Rubber Cushion & Clamps  
 07-02-19 JLM  
 \*\*\*\*CHANGE TO CHG 005 - IF USING D2894-1 B35578 OR  
 GREATER\*\*\*\*

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D407-667-205CHG004

2.0 D6011115 Crosstube Material



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6011-115 Crosstube 34689

Check OD = 2.750"; ID = 1.450"

20 08/02/01

①

3.0 MORI SEIKI MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand &amp; install plugs DT8531 on both ends as per Folio FA248

2-Turn first side as per Folio FA248

3-Deburr &amp; Inspect for surface damage. Repair damage within limits as per Dwg D407-667-245.

20 08/02/06

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 10:55:42 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 407 HIGH AFT X-TUBE ASSEMBLY

Job Number: 37006

Part Number: D407667205

Job Number:



Seq. #:

Machine Or Operation:

Description :

4.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

RD 08/02/06

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA248

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D407-667-245

3-Remove sand and plugs

4-Scribe part # and batch # using vibrating stylus as per Dwg D407-667-245  
Inside of Cuff(Donot engrave on outside of tube)

RD 08/02/06

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

RD 08/02/06 ①

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

RD 08/02/06 ①

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

AWM 8-2-11

1-Polish entire outside surface of crosstube

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP 8-2-11

10.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1  
Ensure no sand is in the tube before alodine.

AWM 8-2-11

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 10:55:42 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 407 HIGH AFT X-TUBE ASSEMBLY

Job Number: 37006

Part Number: D407667205

Job Number:



Seq. #:

Machine Or Operation:

Description :

11.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Bend tube as per Dwg D407-667-245 using CNC bender program 407 Aft and Folio FT

P70

KZ 8-2-11

12.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes in tube using drill Jig DT8583 & DT8584 as per Dwg D407-667-245. Drill all (3) top holes.

2-Drill and Ream all holes in tube to finish size using drill Jig DT8583 & DT8584 as per Dwg D407-667-245 Check dimensions between holes on all four sides.

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

4-Drill pilot holes using drill Jig DT8583 & DT8584 as per Dwg D407-667-245. Drill only the top (2) holes.

5-Drill & ream the top (2) holes to finish size using drill Jig DT8583 & DT8584 as per Dwg D407-667-245

6-Drill Aft rivet holes using drill Jig DT8789 as per Dwg D407-667-245. Note: Aft side has 3x top holes.

7-Drill Fwd rivet holes using drill Jig DT8789 as per Dwg D407-667-245. Drill only the top (3) holes.

8-C'sink holes as per Dwg D407-667-245. Allow rivet to sit below surface to compensate for paint.

9-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D407-667-245

SWAP

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

# Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D407-667-205 PAR #: NA Fault Category: Prod/Landing gear NCR: Yes No DQA: 2 Date: 28/02/25  
 QA: N/C Closed: 18 Date: 08/02/25

NCR: <u>37006</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
08.02.13	11.0	Tube transferred to bar in the rollers causing it to be over bent, and really low. R.C. correction for the encoder wheel was bustled causing it to mis-function operator did not notice.	<u>[Signature]</u> 08/02/14	opposite side is not bent. keep tube for test bend on new bender. tube is scrap.	<u>[Signature]</u> 8-2-25	<u>[Signature]</u> 08/02/25	<u>[Signature]</u> 08/02/14	<u>[Signature]</u> 08.02.13

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 10:55:42 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 407 HIGH AFT X-TUBE ASSEMBLY

Job Number: 37006

Part Number: D407667205

Job Number:



Seq. #:

Machine Or Operation:

Description :

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

17.0

OUTSIDE SERVICE

OUTSIDE SERVICES



Comment: Sub-Contracting OUTSIDE SERVICES  
Liquid Penetrant Inspection as per QSI 038 Or  
Issue P/O: \_\_\_\_\_ LPI as per ASTM 1417  
Level 2 Attach copy of NDT results to work order

18.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1  
Inspect for transit damage  
Ensure copy of NDT results attached to work order

NFG

19.0

QC6

DIMENSIONAL CHECK



Comment: Inspect for damage & ensure results are as per Dwg D407-667-245

20.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2

21.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint  
Wrap in plastic bag to protect from scratches

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Friday, 1/25/2008 10:55:42 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 407 HIGH AFT X-TUBE ASSEMBLY

Job Number: 37006

Part Number: D407667205

Job Number:



Seq. #:

Machine Or Operation:

Description :

22.0

D2856400

Abrasion Strip



Comment: Qty.: 1.3524 f(s)/Unit Total : 1.3524 f(s)

Pick:

Qty Part number Description Batch

2 D2856-400(Cut to 7.73") Abrasion Strip

23.0

D2873043

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2873-043 Nut Plate

24.0

D2873045

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2873-045 Nut Plate

25.0

D28941

2.750 Support



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D2894-1 Support

26.0

D31901

Chafing Shield



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D3190-1 Chafing Shield

27.0

D3595

Rubber Cushion (per sq ft)



Comment: Qty.: 0.0246 sf(s)/Unit Total : 0.0246 sf(s)

Rubber Cushion

2X .750" X 4.30"

Batch:

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 1/25/2008 10:55:43 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 407 HIGH AFT X-TUBE ASSEMBLY

Job Number: 37006

Part Number: D407667205

Job Number:



Seq. #:

Machine Or Operation:

Description :

28.0

MS20601AD4W8

RIVET



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part number Description Batch

14 MS20601AD4W8 Rivet \_\_\_\_\_

29.0

MS2192022

Clamp(per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch

4 MS21920-22 Clamp \_\_\_\_\_

30.0

MS2192025

Clamp(per MIL-DTL-8783C)



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Clamp(per MIL-DTL-8783C)

Batch: \_\_\_\_\_

31.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install abrasion strips as per QSI 035 using DT8674. Install chafing shield as per Dwg D407-667-245. Note: (3) top holes should be facing up.

2-Install support with magnobond and install clamps as per Dwg D407-667-245. Torque clamps to 80-100 in lb

A/R Magnobond Batch: \_\_\_\_\_

3-Install nut plates as per Dwg D407-667-245. Touch-up rivet heads with Imron paint.

32.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

33.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 1/25/2008 10:55:43 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 407 HIGH AFT X-TUBE ASSEMBLY

Job Number: 37006

Part Number: D407667205

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

AN534A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: \_\_\_\_\_

35.0

MS21042L5

Nut



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Nut

Batch: \_\_\_\_\_

36.0

AN510A

Bolt



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

10 AN5-10A

Bolt \_\_\_\_\_

37.0

AN532A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

4 AN5-32A

Bolt \_\_\_\_\_

38.0

AN960JD516

Washer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

18 AN960JD516

Washer \_\_\_\_\_

39.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

40.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D407-667-205

Location: \_\_\_\_\_

PPP Rev: \_\_\_\_\_

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 1/25/2008 10:55:43 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 407 HIGH AFT X-TUBE ASSEMBLY

Job Number: 37006

Part Number: D407667205

Job Number:



Seq. #:

Machine Or Operation:

Description :

41.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



*in 2006/2/14*



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



<b>DART AEROSPACE LTD</b>		<b>Work Order:</b>	31006
<b>Description:</b> Crosstube Assembly		<b>Part Number:</b>	D407-667-245
<b>Inspection Dwg:</b> D407-667-245 <b>Rev:</b> D		<b>Page 1 of 1</b>	

### FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype


Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.490			
	1.832	+0.005/-0.000	1.832			
	1.838	+0.005/-0.000	1.842			
	1.892	+0.005/-0.000	1.896			
	2.052	+0.005/-0.000	2.056			
	2.206	+0.005/-0.000	2.208			
	2.521	+0.005/-0.000	2.525			
	2.633	+0.005/-0.000	2.635			
	4.10	+/-0.030	4.10			
	4.978	+/-0.030	4.978			
	2.040	+0.000/-0.010	2.033			
	0.125	+/-0.010	.130			
	R0.063	+/-0.010	R.06			
	R0.500	+/-0.010	R.5			
SIDE B	2.490	+0.005/-0.000	2.490			
	1.832	+0.005/-0.000	1.832			
	1.838	+0.005/-0.000	1.838			
	1.892	+0.005/-0.000	1.893			
	2.052	+0.005/-0.000	2.052			
	2.206	+0.005/-0.000	2.206			
	2.521	+0.005/-0.000	2.525			
	2.633	+0.005/-0.000	2.635			
	4.10	+/-0.030	4.1			
	4.978	+/-0.030	4.978			
	2.040	+0.000/-0.010	2.033			
	0.125	+/-0.010	.130			
	R0.063	+/-0.010	R.06			
	R0.500	+/-0.010	R.5			
	112.91	+/-0.020	112.927			

<b>Measured by:</b>	26	<b>Audited by:</b>	LF	<b>Prototype Approval:</b>	N/A
<b>Date:</b>	08/02/06	<b>Date:</b>	08/02/06	<b>Date:</b>	N/A

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-205)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	06.03.30	Tolerance revised for 4.978 dimension	KJ/JLM	
D	07.02.19	Dwg Rev updated	KJ/JLM	

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b>	37006
<b>Description:</b> Crosstube High Aft (407)		<b>Part Number:</b>	D407-667-205
<b>Inspection Dwg:</b> D407-667-245 <b>Rev:</b> D		<b>Page 1 of 1</b>	

Required Dimension	Min	Max
Height	23.46	23.58
1/2 Span	45.86	45.98
Angle	54	56
Total Span	91.72	91.96

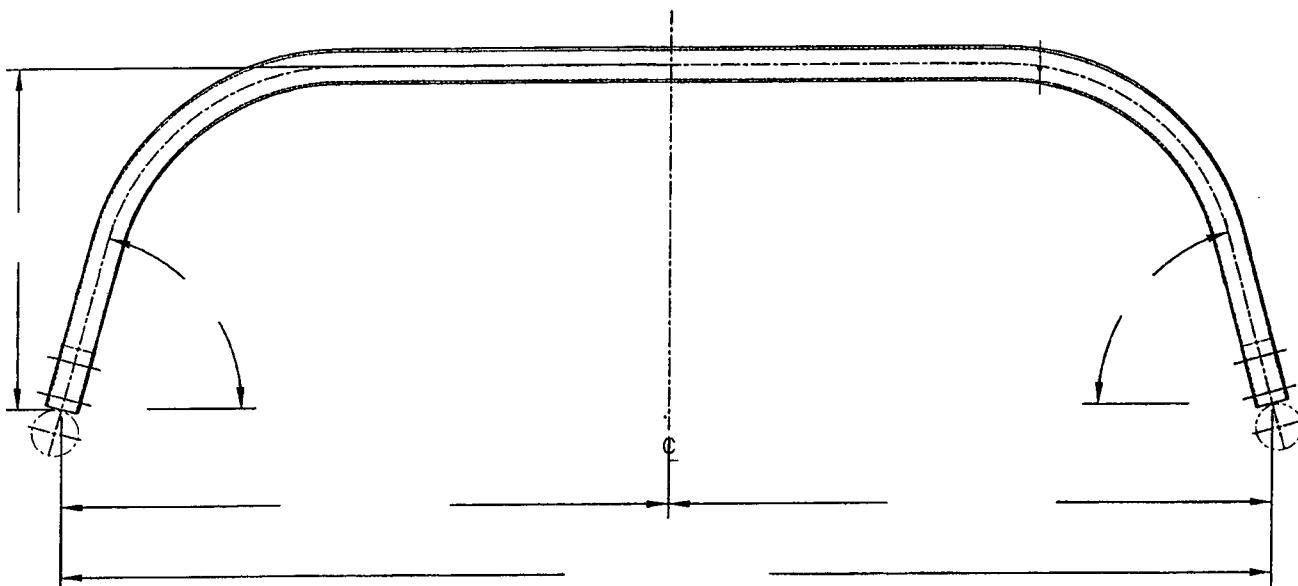

Comments

QC15 Inspection	
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	<i>[Signature]</i>

**DART**

DESIGN <i>PH</i>	DRAWN BY <i>PH</i>	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D407-667-245	REV. D SHEET 1 OF 3
DATE 07.02.07		TITLE CROSSTUBE ASS'Y (407 HIGH AFT)	SCALE NTS
A	02.05.13	NEW ISSUE	
B	03.05.21	ADD CHAFING SHIELD	
C	05.07.26	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	
D	07.02.07	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE -851 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION	

RELEASED

07.02.14 *[Signature]*


Qty	Part Number	Description
X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
1	D6011-115	CROSSTUBE
2	D2856-400-773	ABRASION STRIP
2	D2873-043	NUT PLATE
2	D2873-045	NUT PLATE
1	D2894-1	SUPPORT
2	D3190-1	CHAFING SHIELD
2	D3595-075-430	RUBBER CUSHION
14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
4	MS21920-22	CLAMP
2	MS21920-25	CLAMP (OR MS21920-24)

**GENERAL NOTES:**


- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6011-115  
FINISHED LENGTH = 112.91±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 12) INSTALL MS21920-25 CLAMPS WITH D3595-075-430 RUBBER CUSHIONS TO SECURE D2894-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.  
**NOTE:** MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- 13) TORQUE CLAMPS 80 TO 100 IN-LB.
- 14) INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS ON BOTTOM SIDE OF CROSSTUBE OPPOSITE D2894-1 SUPPORT.

SHOP COPY  
RETURN TO  
ENGINEERINGUNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 37006**Copyright © 2002 by DART AEROSPACE LTD**


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

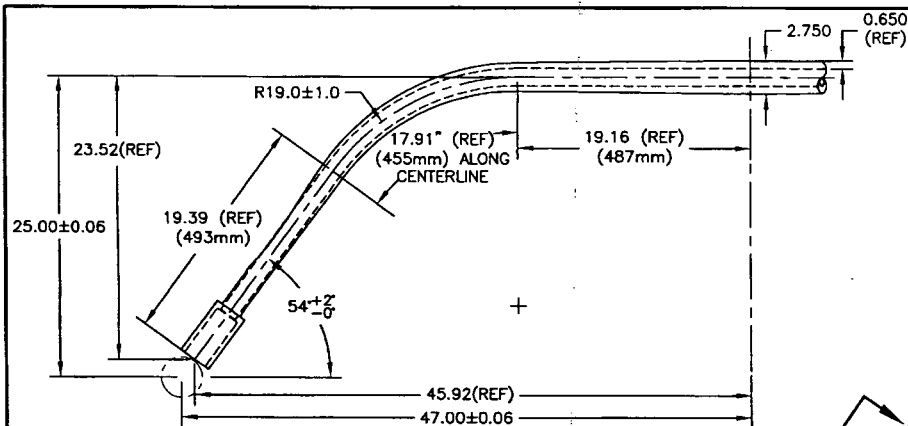


**BENDING DETAIL**  
SCALE 2:5

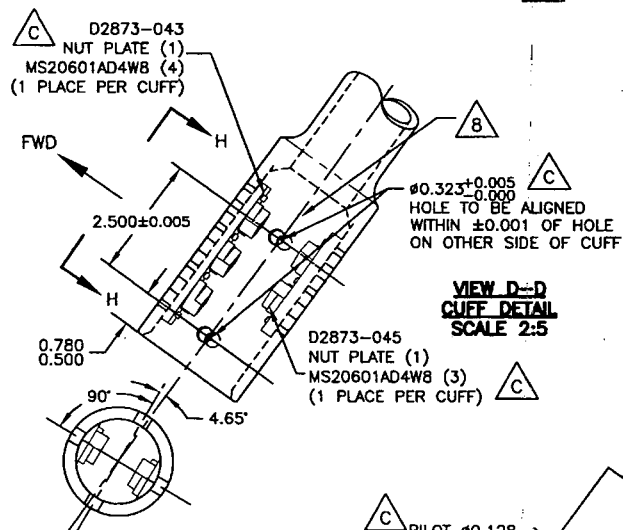


**VIEW D-D  
CUFF DETAIL**  
SCALE 2:5

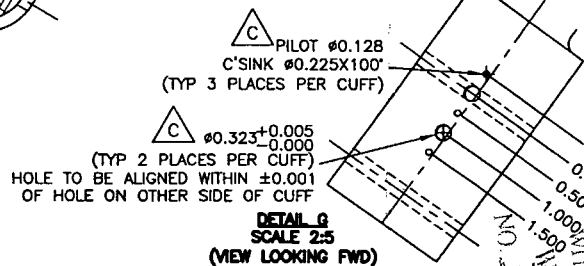


**DETAIL G**  
SCALE 2:5  
(VIEW LOOKING FWD)

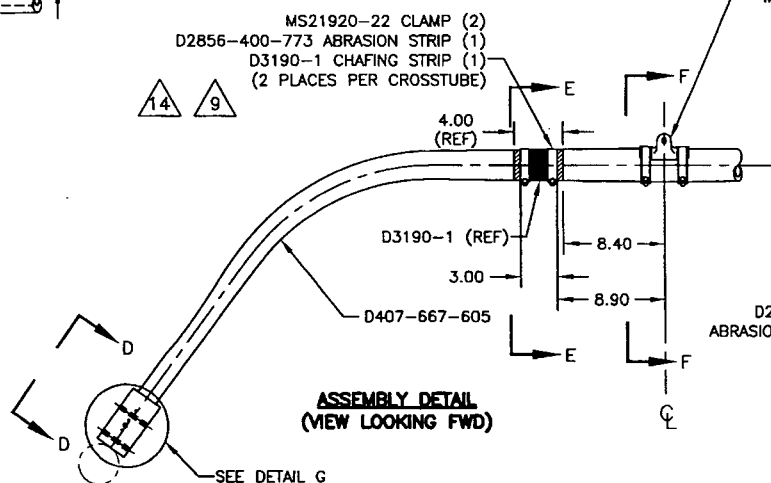

**ASSEMBLY DETAIL**  
(VIEW LOOKING FWD)

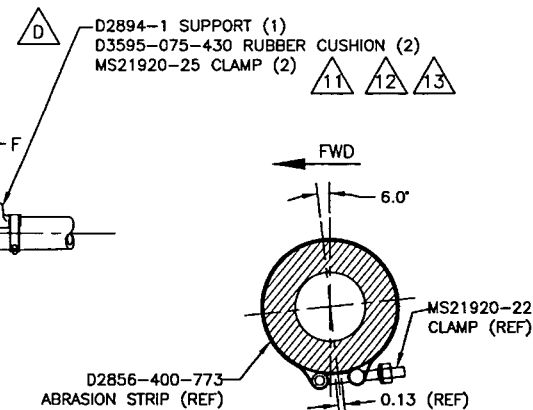

**SECTION E-E**  
SCALE 2:5

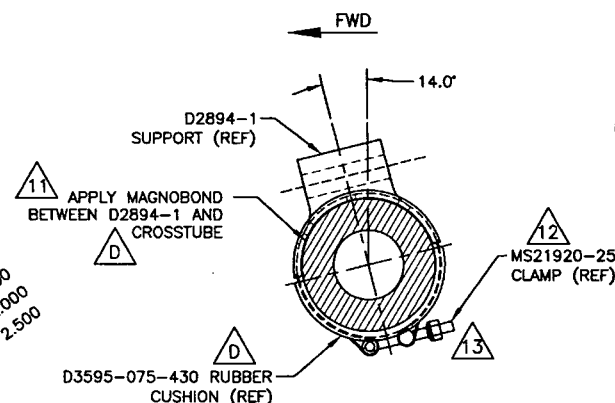

**SECTION F-F**  
SCALE 2:5

COPYRIGHT © 2002 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN PH

CHECKED PH

DATE 07.02.07

DRAWN BY PH

APPROVED PH

**DART**

**DART AEROSPACE LTD.**  
HARRISBURG, ONTARIO, CANADA

DRAWING NO.  
D407-667-245

TITLE  
CROSSTUBE ASS'Y (407 HIGH AFT)


REV. D

SHEET 2 OF 3



SCALE

1:10

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
FOR ORDER  
NOTICE  
1.000  
0.500  
0.000  
0.500  
1.000  
1.500  
2.000  
2.500

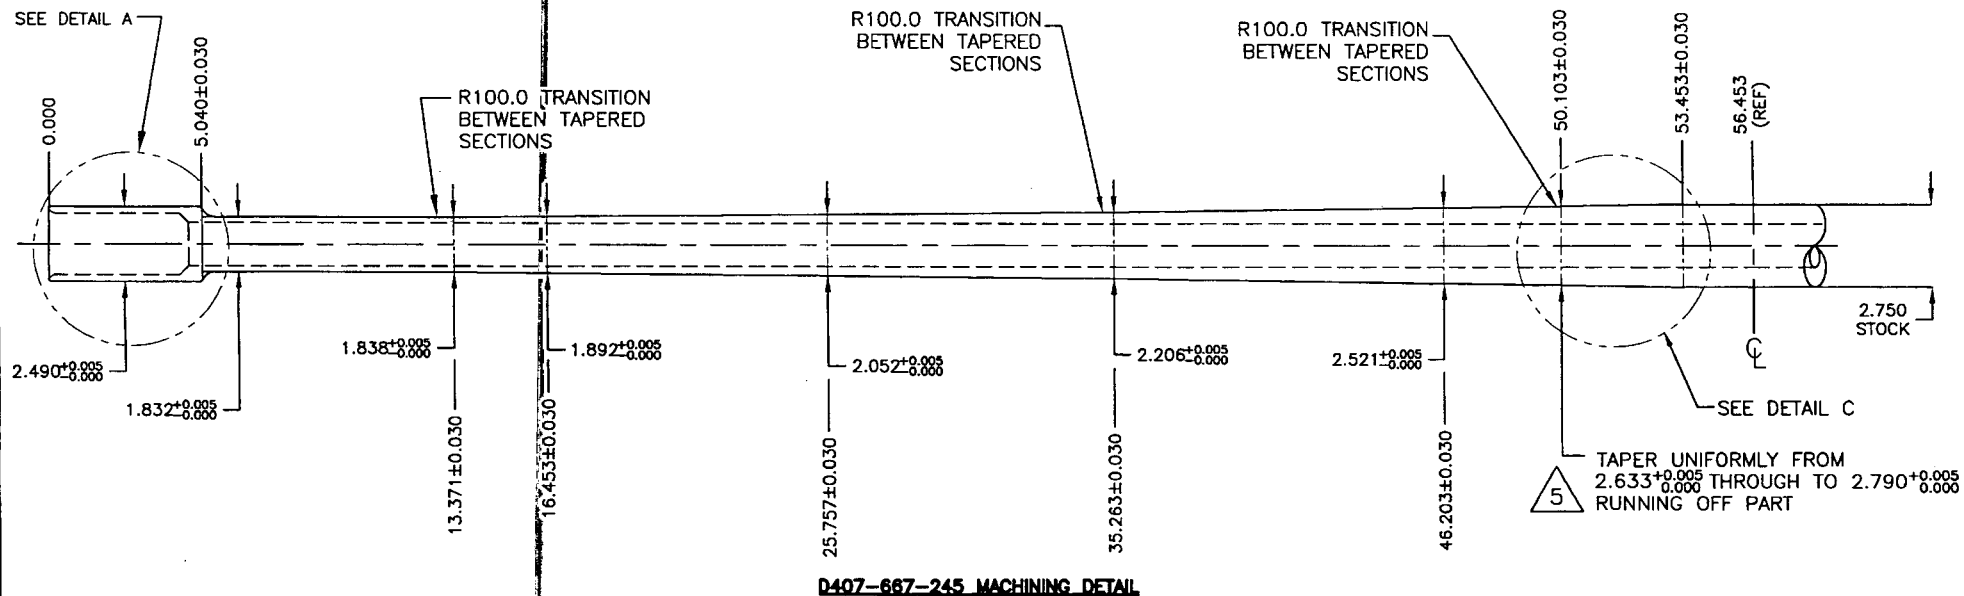


**DETAIL A: CROSSTUBE CUFF**  
(SCALE 3:4)

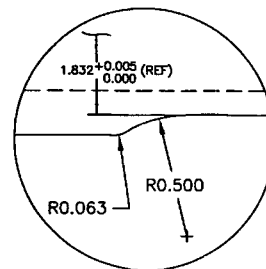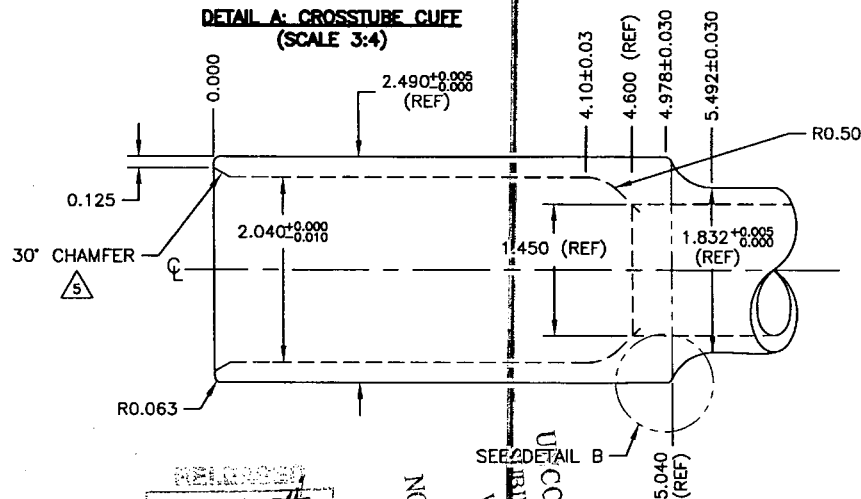


**DETAIL B: CUFF TRANSITION**  
SCALE 2:1

**DETAIL C: TAPER RUN-OFF**  
NOT TO SCALE

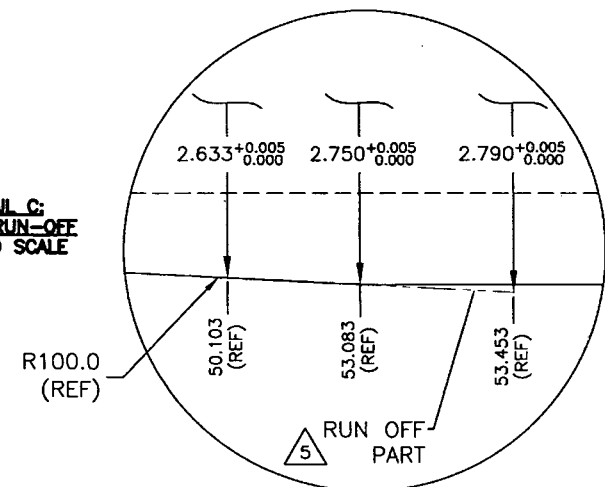

RELEASED  
07.02.14

NO. 39006  
WORK ORDER  
WITHOUT NOTICE  
ENGINEERING  
CONTROLLED COPY  
DIRECT TO AMENDMENT  
RETURN TO  
SHOP COPY

COPYRIGHT © 2002 BY DART AEROSPACE LTD.		DESIGN PH	DRAWN BY PH	 <b>DART AEROSPACE LTD.</b> WILKESBURY, ONTARIO, CANADA	REV. D SHEET 3 OF 3
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED PH	APPROVED PH		
DATE 07.02.07		DRAWING NO. D407-667-245		SCALE	
		TITLE CROSSTUBE ASS'Y (407 HIGH AFT)		1:4	

